



FIELD REPORT

(107071004)

Started June 21.....19.76
 Completed..June 24.....19.76

KFN-6 (1)

NAME AND ADDRESS OF CLIENT	DESCRIPTION OF WORK	LOCATION OF WORK
Dept. of Indian Affairs and Northern Dev.	Water Well	Indian village Burwash landing


FORMATION LOG			DESCRIPTION OF WORK	TIME			
FROM	TO	FORMATION		DATE	FROM	TO	HOURS
			MOVE Travelling	June 21	8:30pm	1:30am	5
0'	6'	sand, gravel brown silt	moving on site set up	June 22	10:am	9:pm	11
6'	24'	coarse gravel silt	Ran 70' of 8" casing	June 23	7:am	11:pm	14
24'	70'	clay till (Frozen)					
70'	148'	clay till	Ran 152'8" of casing				
48'	154'	brown silty clays	jetting and bailing				
154'	157'	sand gravel	pressurizing, bailing	June 24	8:1am	6:30	10.5
157'	162'	clay till	moving off site				
			Travelling		9:30pm	2:30am	5

Rcd. of Casing & Pipe				Remarks: Welded 6" telescoping screen to the bottom			
Size	Type	Size	Type				
8"		6"		of 6 5/8" casing. Stainless steel 40 slot			
Feet	Inch	Feet	Inch	Bailed at 2.5 G.P.M. Recommend setting bottom of pump at 145'			
25	2 1/2"	12'					
25	1 1/2"	20	10				
20		20	10				
		20	10				
		20	10	STATIC LEVEL Not recorded because			
		20	10	Total Rig Time		45.5	hrs.
		20	10	Total Standby			hrs.
		15	8	Top of casing		Drilling Mud	18 sacks

SIGNATURES

MIDNIGHT SUN.....
 TITLE.....

CLIENT.....
 TITLE.....

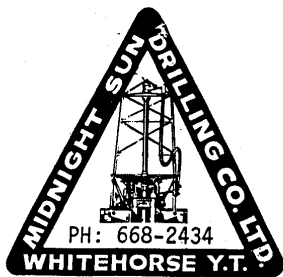

P.O. Box 4391

FIELD REPORT

KFN-G (2)

Started June... 21... 1976

Completed June... 24... 1976

NAME AND ADDRESS OF CLIENT	DESCRIPTION OF WORK	LOCATION OF WORK
Indian Affairs	water well	Burwash

FORMATION LOG			DESCRIPTION OF WORK	TIME			
FROM	TO	FORMATION		DATE	FROM	TO	HOUR
			MOVE				
			Pressurizing	June 24	8:00	10:30	2 1/2
			bailing	"	10:30	12:00	1 1/2
			"	"	1:00	5:00	4
			moving off site	"	5:00	6:30	1 1/2
			Traveling	"	9:30	2:30	5

Rcd. of Casing & Pipe				Remarks:
Size	Type	Size	Type	
Feet	Inch	Feet	Inch	WELDED 6" TELESCOPING SCREEN TO THE BOTTOM OF 6 3/8" CASING. STAINLESS STEEL 40 SLOT BAILED AT 2:5 P.M.
				RECOMMEND SETTING BOTTOM OF PUMP AT 145'
				STATIC LEVEL (NOTE RECORD) Total Rig Time 14 1/2 hrs.
				Ground level BECAUSE OF Total Standby hrs.
				Top of casing SLOW RECOVERY Drilling Mud sacks

SIGNATURES

MIDNIGHT SUN.....
TITLE.....

CLIENT.....
TITLE.....